

## Technical Data Sheet **Cypox Gel Bonder**

### **Product Description**

Cypox Gel Bonder is a single component high viscosity gel cyanoacrylate adhesive. Ideal for bonding porous materials or when controlling adhesive flow is critical. Offers maximum gap filling and repositioning time.

### **Physical Properties**

#### **Monomer (Liquid)**

Base Compound	Ethyl Cyanoacrylate
Appearance	Colorless Liquid
Viscosity (cP @ 68°F)	Thixotropic
Specific Gravity (g/cc)	1.08
Flash Point (TCC)	176°F
Shelf Life @40°F	1 year unopened

#### **Military Specifications**

Mil-A-46050C  
 Type II, Class 4

#### **Curing Properties**

Ambient surface moisture will initiate the hardening process. Handling strength is reached in a short period of time and varies depending on environmental conditions and substrates being bonded. Product will continue to cure for at least 24 hours before full strength and resistances are developed.

#### **Setting Time (68°F, 65% R.H.)**

Steel	50 to 70 seconds
Aluminum	30 to 60 seconds
Neoprene	20 to 30 seconds
ABS	25 to 50 seconds
Polycarbonate	50 to 75 seconds
PVC	20 to 35 seconds

#### **Curing Performance**

The gap of the bond line will affect set speed. Smaller gaps tend to increase the speed. Activators can be applied to improve set speed but may also impair overall adhesive performance.

#### **Polymer (Cured)**

Appearance	Colorless Solid
Service Temperature Range	-65°F to 200°F
Softening Point	293°F
Refractive Index (ND 20)	1.49
Full Cure Time	24 Hours
Dielectric Strength (KV/mm)	11.6
Dielectric Constant (@ 1Kc)	5.4
COE (in./in./F)	.000126
Tensile Strength (steel/steel)	3500 psi
Solubility	Nitromethane, Acetone, Dimethylformamide


#### **Performance of Cured Materials**

Tensile Shear strength after 48 hours at 20° to 25°C

Substrate	Range in N/mm2
Blasted Steel	18 to 25
Etched Aluminum	13 to 20
Neoprene	> 10
ABS	> 6
Polycarbonate	> 5
PVC	> 6

#### **Temperature Resistance**

Sheer Strength on steel after 1 week at 22 °C

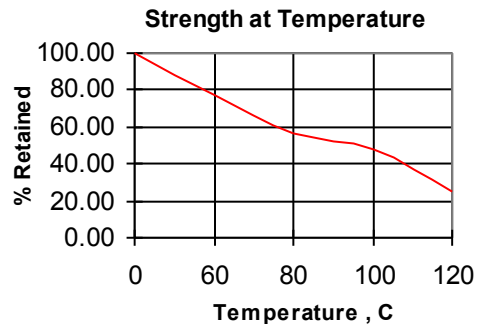

Technical Data Sheet  
**Cypox Gel Bonder**

**Chemical Resistance**

Sheer strength on steel after 12 month soak

<b>Solvent</b>	<b>% Strength Retained</b>
Motor Oil	100
Gasoline	100
Trichloroethane	100
Freon TA	100
10% NaOH	0
10% Hcl	0
Water	0

**For safe handling information on this product, consult the Material Safety Data Sheet, (MSDS)**

**NOTE**

The data contained herein are furnished for information only and are believed to be reliable. Gowest2 International, L.L.C. cannot assume responsibility for the results obtained by others over whose method Gowest2 International, L.L.C. does not control. It is the user's responsibility to determine suitability for the product or of any production methods mentioned herein and to adopt such precautions as may be advisable for the protection of property and of persons against any hazards that may be involved in the handling and use thereof. In light of the foregoing, **Gowest2 International, L.L.C. specifically disclaims all warranties of merchantability or fitness for a particular purpose arising from sale or use of Gowest2 International, L.L.C. products. Gowest2 International, L.L.C. specifically disclaims any liability for consequential or incidental damages of any kind, including loss of profits.** The discussion herein of various processes or compositions is not to be interpreted as representation that they are free from domination of patents owned by others or as a license under any Gowest2 International, L.L.C. patents which may cover such processes or compositions. We recommend that each prospective user test the proposed application to determine its suitability for the purpose intended prior to incorporating any product or application in its manufacturing process using the data as a guide.

**General Instructions**

Surfaces to be bonded should be clean and dry. Dispense a drop or drops to one surface only. Apply only enough to leave a thin film layer after compression.

Press parts together and hold firmly for a few seconds. Good contact is essential. An adequate bond develops in less that one minute and maximum strength is attained in 24 hours.

Wipe off excess adhesive from the top of the container and recap. Apollo products if left uncapped may deteriorate by contamination from moisture in the air.

Because Cypox Gel Bonder products cure by polymerization, whitening may appear on the surface of the container or the bonded materials. Should this happen, wipe surfaces well with acetone.

**Storage**

Products should be stored unopened in a cool, dry place out of direct sunlight. Products can be refrigerated for improved shelf life but should be brought back to room temperature before use.